

OP-909 INDICATOR




FEATURES

- Multiple weighing units: lb/kg or lb/kg/g/oz/lb-oz (on upgraded model)
- Gross/Tare/Pre-Set Tare/Zero
- Multiple Hold functions
- Overload / Underload alarm
- Power saving mode
- Automatic date and time update
- Ability to modify gravity based on different geographical locations
- 100% manual zero range setting
- Automatic error warning alarm
- Splash proof keyboard and display
- Bright LED display easy to read both indoor and outdoor
- Displays up to 50,000 graduations
- Mounting bracket and Hardware (included)
- Operates on 110V AC adapter and rechargeable battery (included)
- Full Duplex RS-232 Serial Port
- Drives up to 8 350Ω load cells
- 1 Year Warranty

ACCESSORIES

- Thermal Ticket Printer
- Label Printer
- Zebra Label Printer
- Remote Display
- Stainless Steel Stand
- I/O Card to control external system

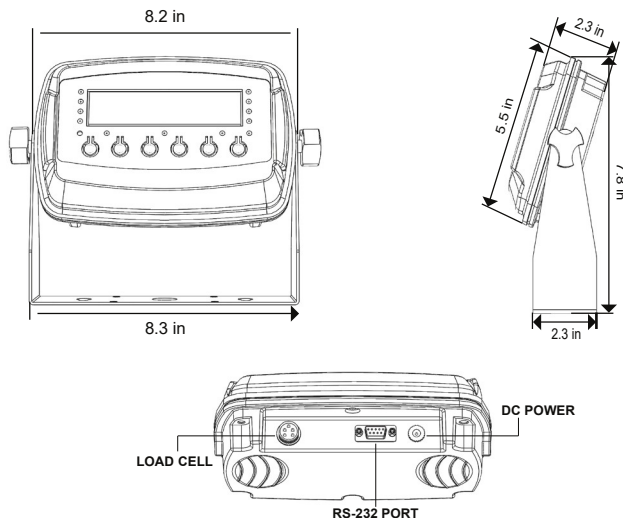

SPECIFICATIONS

- Display:**
LED; 1-inch x 6-digit numeric
- Units:**
lb, kg (primary); oz, lb:oz, g (secondary)
- Accuracy Class:**
10,000 e
- Resolution:**
120,000 dd industrial; 10,000 dd HB44
- Excitation Voltage:**
5V DC
- Largest output current:**
120 mA
- Excitation Circuit:**
5 VDC, 4 wire connections
- Load Cell:**
8 load cells of 350 Ω maximum
- Load Cell Excitation:**
5 ± 0.5VDC
- Display Resolution:**
30,000 ; ADC: 2,000,000
- Zero stability error:**
TK0 0.1μV//K
- Sensitivity (internal):**
0.3μV/d
- Input voltage:**
-30 to +30mV DC
- Power:**
100~240VAC @50~60hz
- Battery:**
6V 1.3Ah
- Operating Temp.**
14°F to 104 °F(-10°C to 40°C) ≤90%RH
- Weight:**
4.3 lbs (1.95 kg)
- Internal Resolution:**
120,000 dd industrial; 10,000 dd HB44
- Display Increment:**
Selectable 1, 2, 5, 10, 20, 50
- Conversion Rate:**
12 samples/second typical
- Analog Signal Input Range:**
1mV/V to 3mV/V
- Analog Signal Sensitivity:**
0.1 uV/graduation (min)
- Measurement Rate:**
0~15mV
- Auto Zero Tracking:**
0 - 5 dd increments
- Auto Zero Delay:**
0 - 3 second increments
- Motion Detect:**
1 - 10 dd
- Motion Delay:**
1 - 55 dd